

JMA Weather Protection System™

WPS-2MT-14S-01, for 1/4" 2.2-5 Connector to Port



Materials (all sold separately)



WPS-2MT-14S-01
weatherproofing boot



WPS-2F-01
(2) 2.2-5 port seals



UXP-2MT-14S-01
2.2-5 connector



TQ-916-F6
torque wrench

Step 1: Install WPS-2MT-14S and port seal



Prior to cable prep, slide the WPS-2MT-14S-01 boot onto the 1/4" cable 8–12" from the end.



Prep the 1/4" cable and install the JMA 1/4" 2MT connector. Refer to the connector installation instructions.



Install port seal with tapered side toward the nut. Seal is black in color.

Step 2: Connect and torque interface




Mate the male connector to the port.



Torque the connector to 6 lbf-ft using the TW-916-F6 torque wrench.

WPS-2F compatible port specification

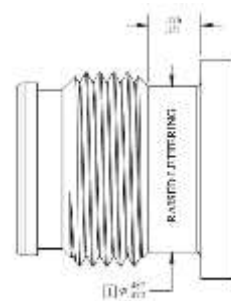

Step 3: Install JMA WPS to seal interface



Slide the WPS-2MT-14S-01 over the port seal until ribs are no longer visible.



Properly installed WPS-2MT-14S-01.
NOTE: all ribs of the port seal are fully covered by the WPS.

- 1 Surface to be free of flats, threads, or raised lettering whose characters are taller than 1/16".